
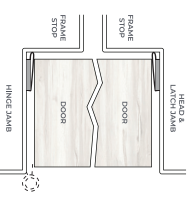


# NCP 9750

## Fire and Smoke Seal



- Self-Adhesive Intumescent
- Flame Resistant
- 1/2" Wide x 3/16" Tall
- Available in 36", 48", 84", 96" and 108" Lengths

# SEAL



See [ngpp.com](http://ngpp.com) for All Applicable Certifications for this Product.



POSITIVE PRESSURE TESTED GASKETING MATERIALS FOR FIRE DOORS FOR APPLICATION TO HOLLOW-METAL-TYPE FIRE DOORS RATED UP TO 3 HOURS AND WOOD-TYPE FIRE DOORS RATED UP TO 1½ HOURS. CATEGORY C, H

SMOKE AND DRAFT CONTROL GASKETING (CATEGORY H) TESTED TO UL 1784; MEETS REQUIREMENTS OF NFPA 105, IBC FOR USE ON "S" LABEL DOORS.



POSITIVE PRESSURE TESTED MISCELLANEOUS FIRE DOOR ACCESSORY



For use on 20 minute UL10B, UL10C and CAN/ULC-S104 wood or hollow metal fire doors with head and/or jamb clearance exceeding 1/8", up to 5/16".

An NCP strike shim 9275 or 9225 may be required for proper latchbolt engagement.  
Hinge edge of category B wood doors requires a UL certified category C edge seal.

[ngpp.com](http://ngpp.com)  
1-800-NCP-RUSH

# INSTALLATION INSTRUCTIONS

## 9750

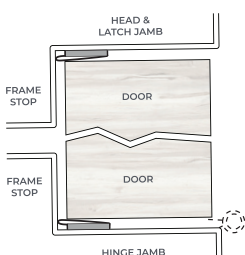

20, 45, 60, 90 Minute Rated Category  
B Wood Doors Perimeter Application  
Up To:  
Single Swing 4'0 X 9'0  
Pairs 8'0 X 9'0

UL Tested and Classified for  
Fire and Smoke Doors.

\* Seals against smoke, fire, air  
and weather.

\* Excellent compression; door  
latches easily.

1. The surface temperature of the frame must be above 50°F for the adhesive to bond properly.
2. Clean frame with clean wipe provided to remove dust, oil, grease and dirt. Wax coated or high gloss painted surfaces may require roughening of the surface with a scotch brite pad or sandpaper so adhesive will properly bond.
3. Measure and pre-cut pieces to fit where seal is to mount. 1/8" clearance required between door and frame.
4. Remove protective backing 1 to 2 feet at a time.
5. Position on frame where illustrated.
6. Adhere by pressing firmly (approx. 15 lbs. pressure required) straight down along entire length of gasketing.  
Do not remove and relocate.
7. Make sure the seal does not impede proper closing and latching of the door.



[ngp.com](http://ngp.com)

1-800-NGP-RUSH

FAX: (800) 255-7874

QUOTES: [quotes@ngp.com](mailto:quotes@ngp.com)

ORDERS: [orders@ngp.com](mailto:orders@ngp.com)

### MEMPHIS

4985 East Raines Road  
Memphis, TN 38118

### CARSON CITY

3689 Arrowhead Drive  
Carson City, NV 89706